Miniature connectors



Product description Push-Pull male cable connector, Contacts: 5, 4.0 - 8.0 mm, shieldable, solder, IP67


Area Push-Pull series 440 Order number 99 4813 00 05


Illustration

Scale drawing

Contact arrangement (Plug-in side)



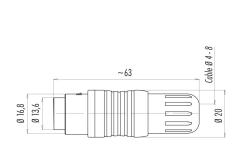

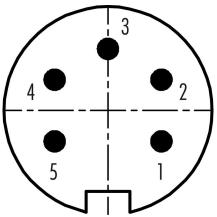

You can find the component part drawing and assembly instructions on the next page.

Technical data

General features

Order number	99 4813 00 05
Connector design	male cable connector
Version	connector male straight
Connector locking system	Push-Pull
Termination	solder
Degree of protection	IP67
Cross-sectional area	max. 0.75 mm² / max. AWG 18
Cable outlet	4.0 - 8.0 mm
Temperature range from/to	-40 °C / 85 °C
Mechanical operation	> 1000 Mating cycles
Weight (g)	23.816
Customs tariff number	85369010

Electrical parameters

Rated voltage	250 V
Rated impulse voltage	1500 V
Rated current (40 °C)	6 A
Insulation resistance	$\geq 10^{10} \Omega$
Pollution degree	1
Overvoltage category	I
Insulating material group	III
EMC compliance	shieldable

Miniature connectors



Product description Push-Pull male cable connector, Contacts: 5, 4.0 - 8.0 mm, shieldable, solder, IP67

Area Push-Pull series 440 Order number 99 4813 00 05

Shield connection Shield Clamping

Material

Housing material	PA GF 25
Contact body material	PBT (UL94 V-0)
Contact material	CuZn (brass)
Contact plating	Au (gold)
REACH SVHC	CAS 7439-92-1 (Lead)
SCIP number	77688166-24b4-4fde-8f99-5522549f43b8


Classifications

eCl@ss 11.1	27-44-01-02
ETIM 7.0	EC002635

Declarations of conformity

Low Voltage Directive	2014/2E/ELL/EN 60204 1:2019:EN 60E20:1001\
Low Voltage Directive	2014/35/EU (EN 60204-1:2018;EN 60529:1991)

Component part drawing

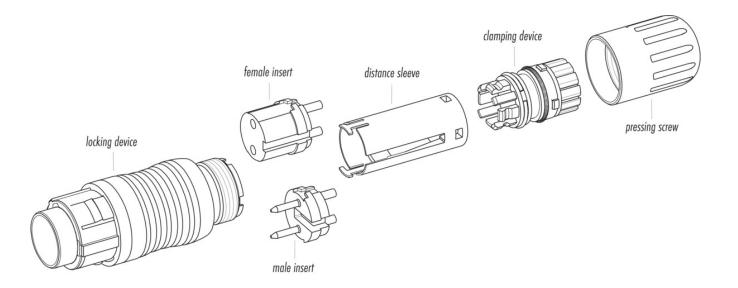

Miniature connectors




Product description Push-Pull male cable connector, Contacts: 5, 4.0 - 8.0 mm, shieldable, solder, IP67

Area Push-Pull series 440 Order number 99 4813 00 05

Assembly instructions

- Strip to 33mm length but do not take off cable jacket.
- Bead pressing screw and clamp device. Remove cable jacket.
- 3. Strip the insulation off the wires and tin them.
- Fan shielding braid and comb out.
 Thread wires around top.
- 5. Lock distance sleeve and clamp device.
- Push mated units backwards over cable (appr. 10mm).
- 7. Solder inserts.
- Push mated units forward until snop-in to contact insert.
- Strip wires towards shielding ring and shorten. too long: wires on sealing ring - not tight too short: no contact to wave washer
- Push assembled unit into carrier sleeve and tighten pressing screw.

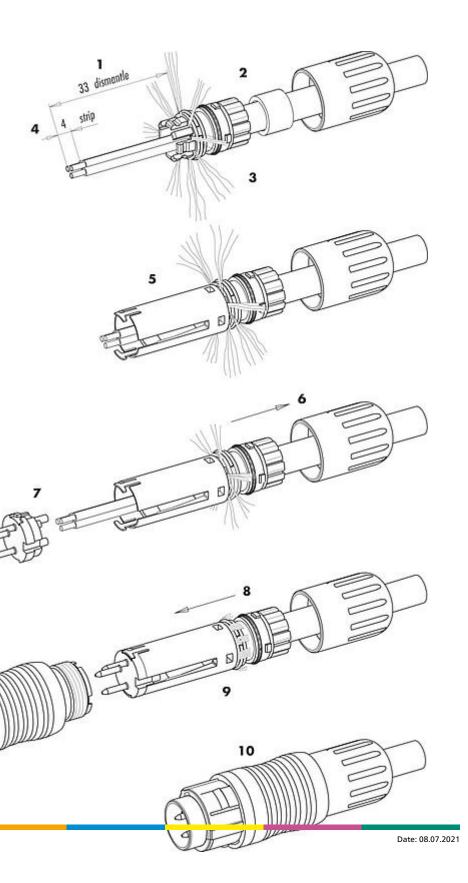

Miniature connectors



Product description Push-Pull male cable connector, Contacts: 5, 4.0 - 8.0 mm, shieldable, solder, IP67

Area Push-Pull series 440
Order number 99 4813 00 05

Security notices

The connector must not be plugged or unplugged under load. Non-observance and improper use can result in personal injury.

The connectors have been developed for applications in plant engineering, control and electrical equipment construction. The user is responsible for checking whether the connectors can also be used in other areas of application.

Connectors which are used in circuits with voltages dangerous to the touch may only be installed and used by, or under the supervision of, persons with electrical engineering training, taking into account the applicable regulations and standards.

Plug connectors with enclosure protection IP 67 and IP 68 are not suitable for use under water. When used outdoors, the plug connectors must be protected separately against corrosion. For further information on the IP protection classes, please refer to the "Technical Information" download centre.

The plug connector is not suitable for mains voltages Please observe the pollution degree and the overvoltage category. For further information, please refer to the download center "Technical Information".