






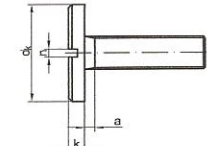
Maße für Schrauben

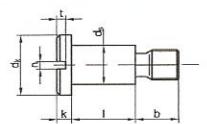
Schlitzschrauben/Kreuzschlitzschrauben mit Maschinengewinde

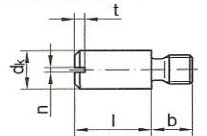
DIN (ISO)	Maße	M 2	M 2,5	M 3	M 4	M 5	M 6	M 8	M 10	
84 (1207)		d_k	3,8	4,5	5,5	7	8,5	10	13	16
	k	1,3	1,6	2	2,6	3,3	3,9	5	6	
	n	0,5	0,6	0,8	1,2	1,2	1,6	2	2,5	
	b	25	25	25	38	38	38	38	38	

DIN	Maße	M 2	M 2,5	M 3	M 4	M 5	M 6	M 8	M 10	
85 (1580)		d_k	4*	5*	6	8	10	12	16	20
	k	1,3*	1,5*	1,8	2,4	3	3,6	4,8	6	
	n	0,5*	0,6*	0,8	1,2	1,1	1,6	2	2,5	
	b	25*	25*	25	38	38	38	38	38	

*) nach ISO 1580

DIN	Maße	M 3	M 4	M 5	M 6	M 8	M 10	
920		a_{max}	1	1,4	1,6	2	2,5	3
	d_k	4	5,5	6,5	8	10	13	
921		k	1,8	2,4	2,7	3,1	3,8	4,60,5
	n	0,5	0,6	0,8	1	1,2	1,6	
	t_{max}	1,15	1,5	1,6	1,9	2,4	2,8	

DIN	Maße	M 3	M 4	M 5	M 6	M 8	M 10	
923		d_k	7	8,5	11	13	16	20
	k	1,8	2,4	2,7	3,1	3,8	4,6	
	b	4,5	6	7	9	11	13,5	
	d_s	4	5,5	7	8	10	13	

DIN	Maße	M 3	M 4	M 5	M 6	M 8	
927		d_k	4	5,5	6,5	8	10
	b	4,5	6	7	8	11	
	n	0,5	0,6	0,8	1	1,2	
	t_{max}	1,05	1,42	1,63	2,0	1,9	